

 
Zero-ring operating manual

Step 1

U HEAD SLIDE



CIRCULAR HEAD SLIDE





Start installing by leveling well head.

Note: Up to 150 meters installing can use U Head Slide, after 150 meters circular head slide prefer.


When you use U head slide, couplings out of round because of the weight.

Step 2

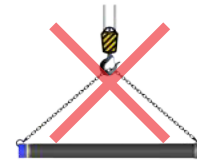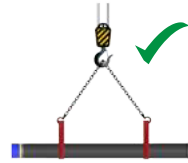


During carrying the column pipes , not use hook etc. Definitely. Carry by centring the column pipe. Be carefull not to damage thread area.

Step 3

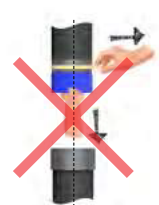



Don't take out thread plastic caps on well head. As shown , take out in free space.

Step 4

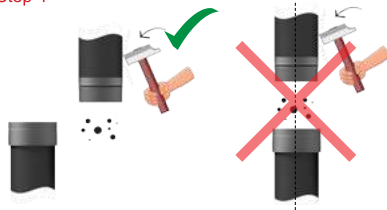



Use hammer on column pipe body to empty flash, swarf etc. Definitely don't maket his on well head.

Step 5

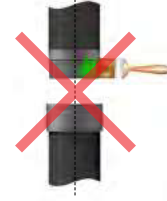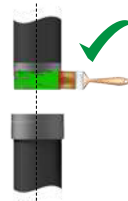

After checking thread cleanliness, use Grease on both thread area and O-ring area. (Don't use paint , resin etc. Otherwise you can not disassemble.)

Step 6

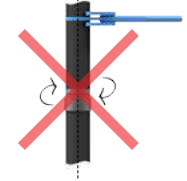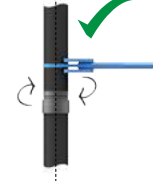

After implanting pin side to box side, screw 3-4 turns by hand. Use pipe wrench on near the threaded area. Not prefer body area in case threads not exposure to swanky.

Because of the tightness property , water is always inside of the pipes. Because of that, take due precautions in winter season while disassembling.

Noncompliance with procedural rules shown above, potential damages during the carrying, installing and disassembling, we are not responsible.